This Service Information bulletin supersedes SI B61 08 00 dated November 2009.

NEW designates changes to this revision

SUBJECT

Closed-circuit Current Measurement

MODEL

All

SITUATION

Increased closed-circuit currents may occur permanently or intermittently and cause the battery to discharge prematurely. The increase in closed-circuit current may be caused by a faulty control unit, or by the installation of a non-approved accessory.

In a situation where a vehicle has broken down due to a discharged battery, **for diagnostic purposes it is important not to disconnect the battery**. This is because a control unit will be reset if the battery is disconnected. Following a reset, the faulty control unit may start functioning correctly again, making accurate diagnosis impossible.

To correctly measure closed-circuit current, the 50-amp clip-on probe (previously used with the MIB) can now be used in conjunction with the IMIB (Integrated Measurement Interface Box) to properly diagnosis closed-circuit current problems over an extended period of time. Connect the 50-amp clip-on probe directly to the IMIB Measurement input 3 (green socket). Refer to SI B04 35 09 for information about the IMIB.

PROCEDURE

- 1. It is very important that any "Power management" faults stored be diagnosed and corrected, and the "Energy Diagnosis" test plan carried out before the following procedure is performed.
- 2. Check and test the battery using the BMW Battery Tester. Refer to <u>SI B 04 25 02</u> for information about the BMW Battery. If necessary, recharge or replace the battery.
- 3. If the battery is installed in the trunk, open the trunk and turn the lock to the locked position, using a screwdriver or similar (simulates the trunk lid being closed). The hood must be closed. If the battery is installed in the engine compartment, open the hood and pull the front lid contact switch fully up, and lock in this position (workshop position, simulates the front lid being closed). The trunk must be closed.
- 4. With the exception of the trunk/hood above, all other doors/lids must be closed.
- 5. In order to simulate normal closed-circuit conditions:
 - Turn the ignition on and activate all electrical consumers, including any accessories. Turn the
 ignition off. In some cases, a drive cycle may need to be carried out in order to duplicate a closedcircuit current problem.
 - o Open and close the driver's door (simulates somebody getting out).
 - o Lock the car, arming the DWA if this is installed.

6. In general, closed-circuit current consistently over 50mA must be investigated. Depending on the vehicle's equipment, closed-circuit current by vehicle model is approximately as follows:

E31	50 milliamps after 16 minutes
E32	50 milliamps after 16 minutes
E34	40 milliamps after 16 minutes
E36, Z3	30 milliamps after 16 minutes
E38	50 milliamps after 16 minutes
E39	40 milliamps after 16 minutes
E46	40 milliamps after 16 minutes
E60, E61, E63, E64	40 milliamps after 60-70 minutes
E65, E66	40 milliamps after 60-70 minutes
E53	40 milliamps after 16 minutes
NEW E70, E71, E72	$40\ milliamps$ after $60\mbox{-}70\ minutes$ with TCU (30 minutes without TCU)
E83	40 milliamps after 16 minutes
E82, E88	$40\ milliamps$ after $60\mbox{-}70\ minutes$ with TCU (30 minutes without TCU)
E90, E91, E92, E93	$40\ milliamps$ after $60\mbox{-}70\ minutes$ with TCU (30 minutes without TCU)
E85	40 milliamps after 16 minutes
E89	$40\ milliamps$ after $60\mbox{-}70\ minutes$ with TCU (30 minutes without TCU)
E52	50 milliamps after 16 minutes
F01, F02, F07	7-21 milliamps after 30 minutes

- 7. New If the nominal milliamp reading is not achieved after the appropriate time, refer to the attached troubleshooting charts. On 2005 MY vehicles equipped with BMW ASSIST, there are additional current fluctuations as high as 500ma that last for approximately 2 minutes. The fluctuations occur every 15 minutes for up to 14 hours after key off. This is considered normal operation of the TCU, and should not be considered a fault. This also applies to 2005 TCUs that are installed into earlier production vehicles as replacement parts.
 - o E60, E63, E64 Closed-Circuit Current Troubleshooting E6x up to 9/05 production
 - o E60, E61, E63, E64 Closed-Circuit Troubleshooting E6x from 9/05 production
 - o E65, E66 Closed-Circuit Current Troubleshooting up to 3/04 production
 - o E65, E66 Closed-Circuit Current Troubleshooting from 3/04 production
 - o Normal closed-circuit current values for E65, E70, E60, E61, E63, and E64 (new with DIS V53)

CLOSED-CIRCUIT CURRENT MEASUREMENT WITH THE IMIB:

Note: This technique with an IMIB is particularly suitable for extended measurements, and provides a graphical readout of recorded measurements over time. It is recommended for situations where the use of a multimeter

provided insufficient information for problem diagnosis.

- 1. The IMIB can be accessed from any ISID within the workshop.
- 2. Select "Activities".
- 3. Select "Measuring devices".
- 4. Select from the "Level 1" column, "Measuring devices", and then "OK".
- 5. From the "Connection manager" screen, select the free IMIB and "Set up connection".
- 6. The "Measures devices" screen opens on the "Multimeter" tab.
- 7. Select the "Oscilloscope" tab.
- 8. Highlight the "CH1" tab to activate channel 1.
- 9. Under channel 1, "Source", scroll with the arrows to select "Clip-on probe 50A".
- 10. Make sure that clip-on probe is not connected to the battery cable, and acknowledge the pop-up message with "OK".
- 11. Change the "A/Div" setting to "1A".
- 12. Under the "Time" selection box, change the "Time/Div" setting based on the number of measurements needed (5 ms to 200 s). The longer times should be selected when performing the measurement over an extended period.
- 13. Select "CH 1" under "Cursor" to monitor the actual readings.
- 14. Select "Record" if performing long term measurements.
- 15. After performing the measurement, select "Record" again; the display will change to "Compress" and display the recorded data on the 1 screen.

WARRANTY INFORMATION

For information only

ATTACHMENTS

view PDF attachment B610800 Troubleshooting E6x from 9 2005.

view PDF attachment B610800 Troubleshooting E65 from 3 2004.

view PDF attachment **B610800 Troubleshooting E6x up to 9 2005**.

view PDF attachment **B610800 Troubleshooting E65 up to 3 2004**.

view PDF attachment B610800 Normal Closed Circuit Current Values.

[Copyright © 2010 BMW of North America, LLC]