



This Service Information bulletin supersedes SI B63 04 10 **dated April 2010.**

NEW designates changes to this revision

SUBJECT

Daytime Running Lamp Bulb Failure

MODEL

E60, E61 (5 Series)

E63, E64 (6 Series)

E70 (X5) produced up to November 29, 2009

E71, E72 (X6) produced up to November 29, 2009

E92, E93 produced up to December 14, 2009

SITUATION

A daytime running lamp bulb has failed. A "bulb out" warning is displayed in the Check Control. The following fault codes are stored:

E60, E61, E63, E64: Fault code A8C4 or A8C5 is stored in the LM (Lamp Module)

E70, E71, E72, E92, E93: Fault code A8C5 or A8C6 is stored in the FRM (Footwell Module)

CAUSE

Premature failure of the "standard life" bulb

CORRECTION

Install a Philips H8 AR "longlife" daytime running lamp bulb on both the left and the right sides of the vehicle. Refer to Repair Instructions REP 63 99 145 (Replacing bulb for left [or right] parking light...).

PARTS INFORMATION

Part Number	Description	Quantity
07 11 9 906 503	Philips H8 AR "longlife" bulb	2

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty.

Defect Code: 63 12 18 12 00

Labor Operation:	Labor Allowance:	Description:
00 00 007*	Refer to KSD2	Performing vehicle test

NEW Refer to KSD2	Refer to KSD2	Replacing both bulbs for front side lights
--------------------------	---------------	--

*Main Work - use this labor operation number when this is the only repair being performed, or if this is the main repair when performed along with other repairs at the same time. If this is not the main repair, refer to KSD for the associated (+) labor operation code.