


**SUBJECT****Eyeblink Lights Are Inoperative After Programming****MODEL**

E60 (5 Series)

SITUATION

After programming with CIP 17.00 or 17.01, the eyeblink lights do not illuminate on vehicles equipped with halogen lights.

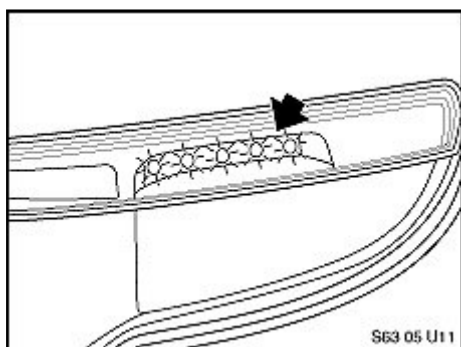

- Eyeblink lights at the top of the front headlights are inoperative.

CAUSE

Coding data in the Lamp Module (LM).

PROCEDURE

Code the complete vehicle per [SI B09 05 01](#) (Coding, Individualization, Programming), Procedure E, using **CIP 18.00.01 (Target Data Status E060-05-06-510)** or higher.

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty.

Defect Code: **63 14 03 12 00**

Labor Operation: Refer to KSD