

4

61-13-1-379-833

SHRINKING HOSE

TOTAL - PARTS

WARR

JOB# 9 TOTALS-----

JOB# 9 JOURNAL PREFIX BMCS JOB# 9 TOTAL

COMMENTS-----

CARRY OVER TO 4/25
 SPECIAL ORDER ENGINE WIRING HARNESS - CPO WARRANTY
 CARRY OVER TO 4/30
 4/30 RECIEVED WRONG WIRING HARNESS . REORDER HARNESS (COMING FROM GERMANY) WILL BE 1 WEEK
 CARRY OVER TO 5/7 - SENT EMAIL 4/30 @ 2:45 PM
 CARRY OVER TO 5/11 - INSTALLING ENGINE HARNESS
 5/16 @ 12:45 - SENT EMAIL - VEHICLE READY

RECOMMENDATIONS-----

TCU + PROGRAMMING \$798.00

TOTALS-----

 *
 * THANKS TO YOU, WE HAVE BEEN AWARDED *
 * *
 * CENTER OF EXCELLENCE *
 * *
 * ONLY 24 DEALERS OUT OF 338 RECEIVED THIS AWARD *
 * *
 * WE ARE THE FIRST WASHINGTON DC METRO AREA *
 * BMW DEALERSHIP TO RECEIVE THIS IN 16 YEARS *
 * *
 * THANK YOU FOR YOUR BUSINESS!!! *
 * *

TOTAL LABOR.....	16.0
TOTAL PARTS.....	0.0
TOTAL SUBLET....	0.0
TOTAL G.O.G.....	0.0
TOTAL MISC CHG.	50.0
TOTAL MISC DISC	0.0
TOTAL TAX.....	0.0
TOTAL INVOICE \$	66.00

CUSTOMER SIGNATURE _____

PAID

CASH CHECK# _____

CHECK NAME _____

ABOR-
1 12BMZ

CEL IS ON
TECH(S):700
CUSTOMER STATES CHECK ENGINE LIGHT/SERVICE ENGINE SOON LIGHT IS ON- CHECK AND ADVISE INTERROGATED FAULT MEMORY. FOUND FAULTS 2EF4-MAP THERMOSTAT 2A1A-TANK VENTING SYSTEM FUNCTION. FOUND THERMOSTAT RECENTLY REPLACED FOR SAME FAULT. PERFORMED TEST PLAN AND CHECKED CONNECTIONS AT THERMOSTAT. CHECKED SIBS AND FOUND SIB121505 VEHICLE IS OUT OF THE PRODUCTION RANGE BUT HAS THE SAME SYMPTOM. CHECKED ALL CONNECTIONS TO DME, THERMOSTAT AND TEMPERATURE SENSOR. CHECKED COOLANT QUALITY AND FOUND FREEZING POINT CORRECT. FOUND CAUSE OF FAILURE TO BE THE WIRING HARNESS CONNECTIONS. ALSO PERFORMED TEST PLAN FOR FUEL TANK VENT FAULT. NO DMTL LEAKS FOUND AT THIS TIME. PERFORMED FUNCTION CHECK OF TANK VENT VALVE AND FOUND VALVE INTERMITTANTLY STICKING OPEN. REPLACED ENGINE WIRING HARNESS AND COOLANT TEMPERATURE SENSOR FOR THERMOSTAT FAULT. REPLACED FUEL TANK VENT VALVE FOR TANK VENTING FAULT
0000006-1251501-1390500-1362531

WARRANTY

ARTS	QTY	FP	NUMBER	DESCRIPTION	UNIT PRICE
	1		13-62-1-433-076	TEMPERATURE SENSOR	
	1		13-90-7-537-113	FUEL TANK VENTILATI	
	1		12-51-7-572-911	ENGINE WIRING HARNE	
	10		12-52-0-007-172	SOCKET TERMINAL SLK	
	10		12-52-0-143-427	SOCKET TERMINAL SLK	
	1		12-52-1-433-915	SOCKET HOUSING	
	1		12-52-1-732-634	PROTECTION CAP	

WARRANTY
WARRANTY
WARRANTY
WARRANTY
WARRANTY
WARRANTY
WARRANTY

TOTAL - PARTS

0.00

ISC	CODE	DESCRIPTION	CONTROL NO
	D-B	DEDUCTIBLE-BMW WTTY	260973

50.00

TOTAL - MISC

50.00

OB# 1 TOTALS

MISC

50.00

JOB# 1 JOURNAL PREFIX BMCS JOB# 1 TOTAL

50.00

OB# 2 CHARGES

ABOR-
2 84BMZ

COMMUNICATION SYSTEM
TECH(S):700
C/S SOS MALFUNCTION / I DRIVE KNOB SPUN FREELY
RECOMMEND REPLACE TCU
TCU FAULT A379
REQUIRES TCU + PROGRAMMING
OWNER ADVISED

0.00

B# 2 TOTALS

JOB# 2 JOURNAL PREFIX BMCS JOB# 2 TOTAL

0.00