

BMW Group - AIR: 2019-03-20 / 09:52  
 Retailer: -/  
 Model: 535xi  
 Vehicle identification number: WBAPT73598CX02203  
 Development code: E61  
 Model code: PT83  
 Lead type: PT83

---

#### Vehicle

### BMW 535xi, 225KW

WBAPT73598CX02203



<b>Development code</b>	E61
<b>Colour</b>	neptun-blau metallic
<b>Actual integration level</b>	E060-11-12-500
<b>Start of warranty</b>	30 August 2008

---

#### Technical campaigns

There are no Technical Campaigns for this vehicle.

---

#### Service contracts

Please check DCSnet Warranty Vehicle Inquiry in DCSnet for available service contracts

---

#### Information on faults workshop/Service Consultation

There is no information on faults.

---

#### Navigation map

**i Note:** The installed map could not be detected.

**i Note:** No free installable maps are available for this vehicle.

---

#### Vehicle details

<b>Vehicle type</b>	Passenger car
<b>Brand</b>	BMW
<b>Model</b>	535xi
<b>Body</b>	TOUR
<b>Vehicle identification number (last 7-digits)</b>	CX02203
<b>Vehicle identification number (17-digits)</b>	WBAPT73598CX02203

Development code	E61
Steering	LL
Engine	N54
Engine number	06096871
Transmission	AUT
Transmission number	4026234W8C
Head unit serial number	No head unit could be found
Drive	ALLR
Integration level, works	E060-08-03-550
Production date	10-Jun-2008
Delivery date	12-Jun-2008
National-market version	USA
Paint number	A85
Upholstery code	LCAD
Model code	PT83
Basic type	PT73

---

### Optional equipment

---

#### Optional equipment ex works:

01CA Selection of COP-relevant vehicles  
 0203 4-wheel drive  
 0205 Automatic transmission  
 0255 Sports leather steering wheel  
 02C0 BMW LA star spoke 124 w flat-runn. prop.  
 02VB Tyre pressure display  
 0300 Emergency spare wheel  
 0302 Alarm system  
 0316 automatic trunk lid mechanism  
 0319 Integrated universal remote control  
 0339 Shadow-Line  
 0354 Windscreen, green-tinted upper strip  
 0386 Roof railing  
 0402 Panorama glass roof  
 0417 Roller sun visor, rear door  
 0430 Interior/outside mirror with auto dip  
 0431 Interior mirror with automatic-dip  
 0438 Fine wood trim  
 0441 Smoker package  
 0442 Drink holder  
 0456 Comfort seat with memory  
 0473 Armrest front  
 0493 Storage compartment package  
 0494 Seat heating driver/passenger  
 0508 Park Distance Control (PDC)  
 0522 Xenon Light  
 0524 Adaptive Headlights  
 0534 Automatic air conditioning  
 0544 Cruise control with brake function

#### Retrofitted optional equipment:

This vehicle has no retrofits.


0563 Light package  
 0609 Navigation system Professional  
 0620 Voice control  
 0639 Preparation f mobile phone cpl. USA/CDN  
 0645 BMW US Radio  
 0655 Satellite tuner  
 0677 HiFi system Professional DSP  
 0694 Provisions for BMW 6 CD changer  
 0697 Area-Code 1 for DVD  
 06AA BMW TeleServices  
 06AB Control, Teleservices  
 06FL USB/audio interface  
 06UH Traffic Information  
 0823 Hot-climate version  
 0845 Acoustic fasten seat belt reminder  
 0850 Dummy-SALAPA  
 0853 Language version, English  
 0876 Radio frequency 315 MHz  
 08S4 Decoding, variable light distribution  
 0925 Dummy-SALAPA  
 0992 Control of number-plate attachment  
 09AA Outer skin protection  
 B110

**Service History**

No Service History available.


**Key history (KeyReader)**

Date when key wa...	Vehicle mileage	Retailer	Key number
18/06/14	146314 km	21188	1
23/05/14	145602 km	21188	1
10/04/14	143224 km	21188	1
10/12/13	136484 km	21188	0

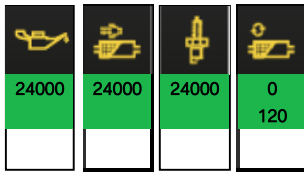


18/11/13

135767 km

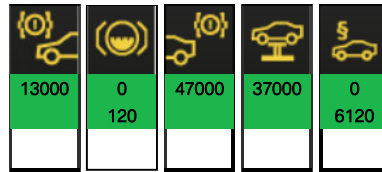


21188

0

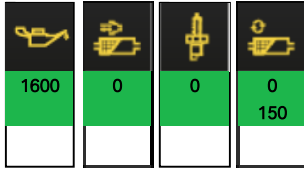


01/08/13

130861 km

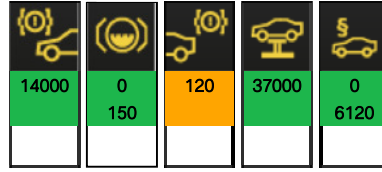


36721

0

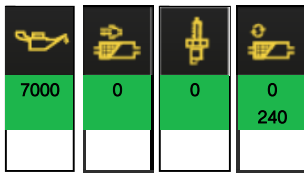

30/05/13

127509 km

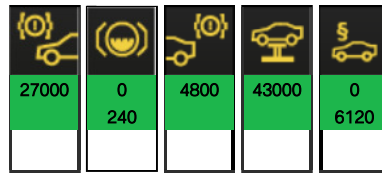


36721

0




01/04/13

122640 km

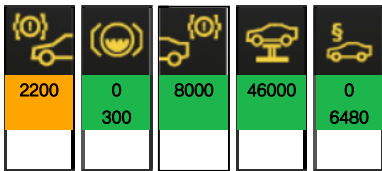


36721

0




27/04/12

103540 km

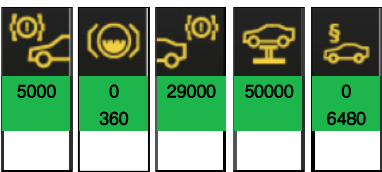


36721

1

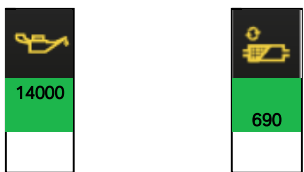


02/04/12

103211 km

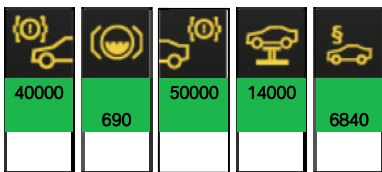


76561

1

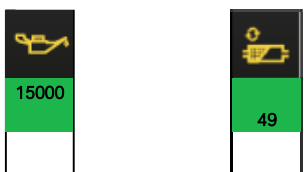




20/12/11

95726 km

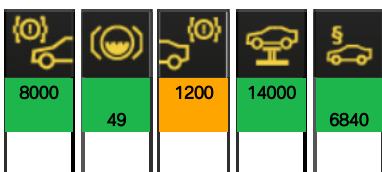

76561

1

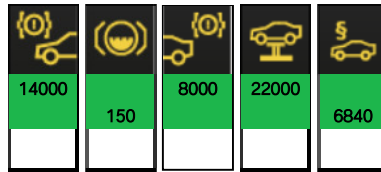


09/12/11

95580 km

76561

0

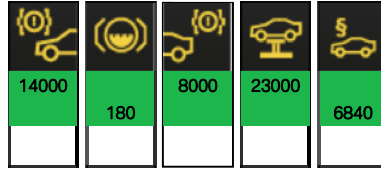


07/12/11

95569 km

76561

0


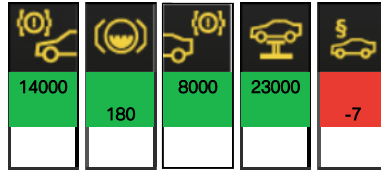


14/09/11

93277 km

76561

0

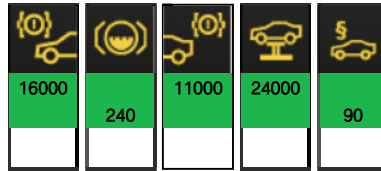



08/09/11

93266 km

76561



0

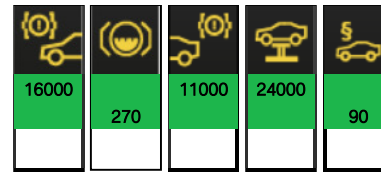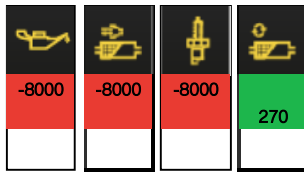

26/08/11

93252 km

16280

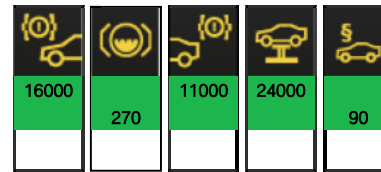
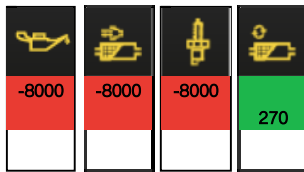


15/02/11

79822 km

16280

0

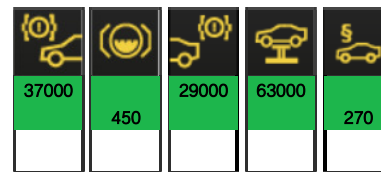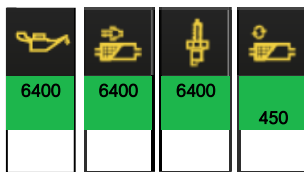

14/02/11

79790 km

16280

0

26/01/11

78121 km

16280


0

25/01/11


78105 km

16280


0

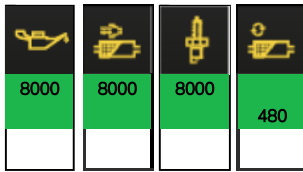


19/10/10 69976 km

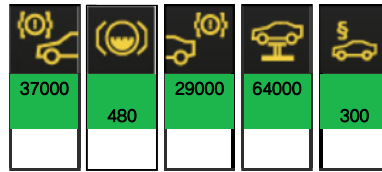


16280

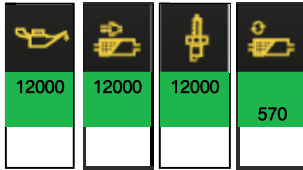


27/07/10 62372 km

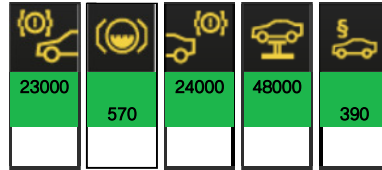

16280

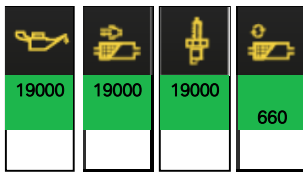


26/07/10 62354 km

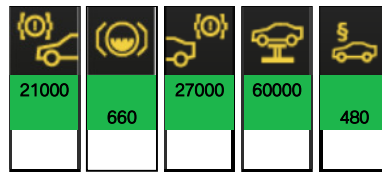


16280

0

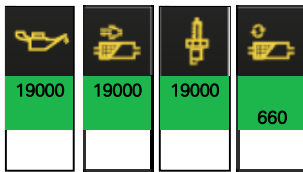


19/06/10 57924 km

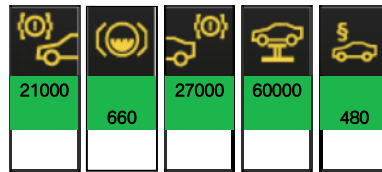


16280

0

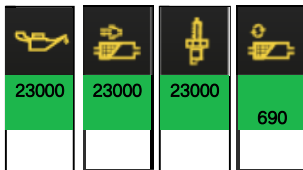


25/05/10 55508 km

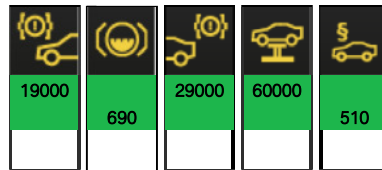


16280


0

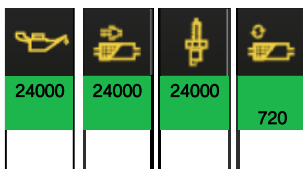


25/05/10 55502 km

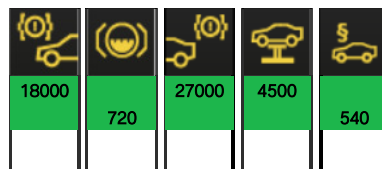




16280

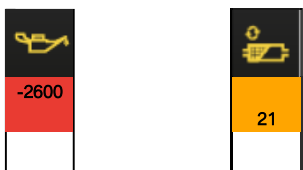

10/03/10 48077 km

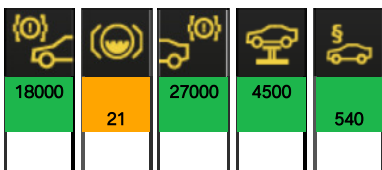

16280

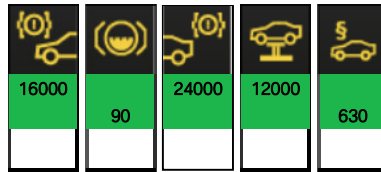



08/03/10

47893 km

76561

0

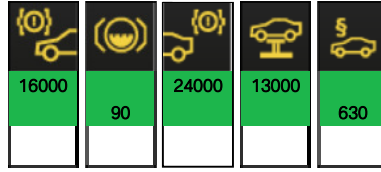



26/02/10

47112 km

16280



0

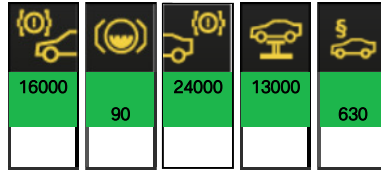

23/02/10

47067 km

16280

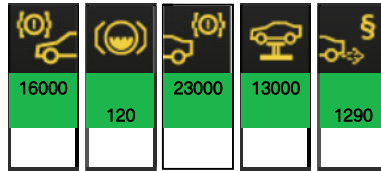


19/02/10

46564 km

86513

0


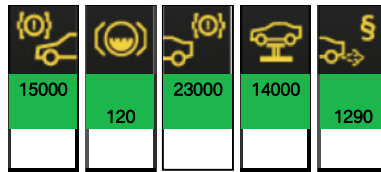


21/01/10

43833 km

16280

0


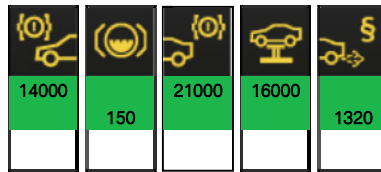



19/01/10

43813 km

16280

0

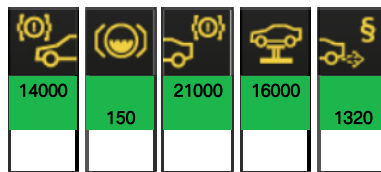


28/08/09

31631 km

16280

0

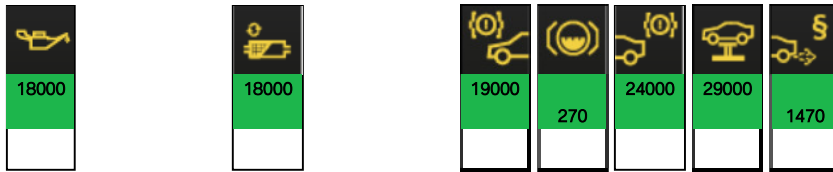


09/06/09

24450 km

16280


0

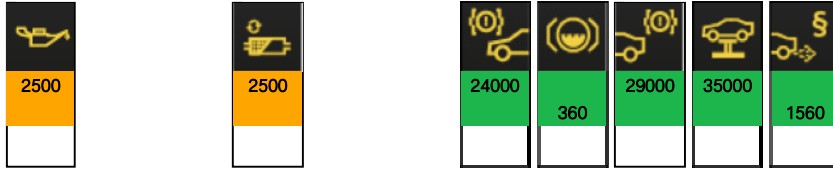

26/05/09

23349 km


16280

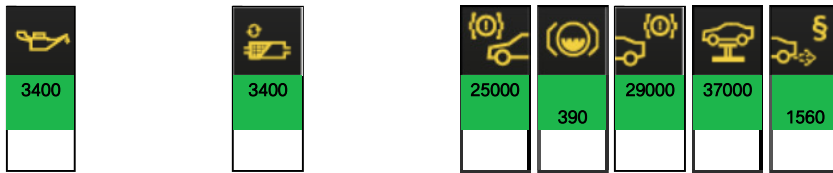

26/01/09

13651 km


16280

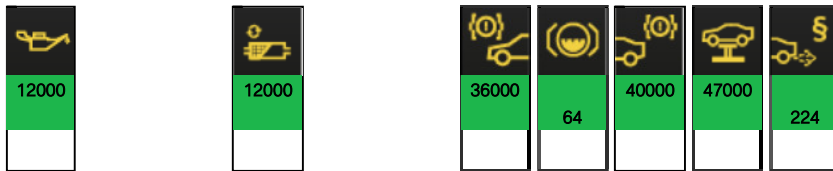

20/11/08

7064 km

16280

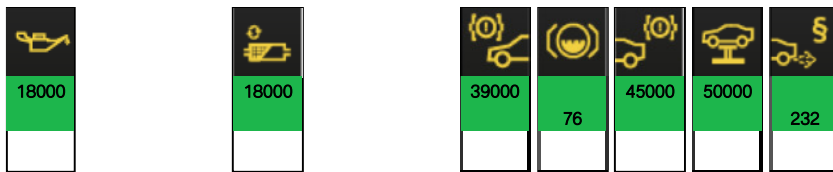

Warranty history

Date of repair	Vehicle mileage	Retailer
23/05/14	145571 km	21188

Job: local description not available

Description local description not available

Replacing left front door sensor  
Flat rate unit | 65 77 741

Sensor door  
Part | 65 77 9 118 167

1.0

Job  
Removing and installing/replacing both exhaust turbochargers  
Flat rate unit | 11 65 548



Recharge vehicle battery  
 Flat rate unit | 61 21 528  
 Performing vehicle test  
 Flat rate unit | 00 00 556

Collar nut 1.0  
 Part | 33 41 1 133 785

Flat gasket 2.0  
 Part | 18 30 7 553 603

Gasket exh.turbocharger/catalytic conv. 2.0  
 Part | 18 30 7 553 601

Exch-turbo charger 1.0  
 Part | 11 65 7 649 293

R134 A Gas 15.0  
 Part | 83 19 2 221 349

O-ring 12.0  
 Part | 11 42 7 558 936

Gasket Asbestos Free 2.0  
 Part | 11 42 2 246 091

Exch-turbo charger 1.0  
 Part | 11 65 7 649 292

Gasket ring 6.0  
 Part | 11 62 7 558 906

Gasket 1.0  
 Part | 11 53 7 545 302

O-ring 2.0  
 Part | 11 42 7 563 453

23/05/14 145571 km 21188

Job: local description not available

**Description** local description not available

10/04/14 143195 km 21188

Job

**Service - standard scope**

Flat rate unit | 00 00 105

Job: local description not available

**Description** local description not available

**Brake fluid service**  
 Flat rate unit | 00 00 618

2.0

**Brake fluid**  
Part I 81 22 0 142 156

Job: local description not available

**Description** local description not available

---

**Microfilter service**  
Flat rate unit I 00 00 616

---

**Microfilter/activated Carbon container** 2.0  
Part I 64 31 9 171 858

Job: local description not available

**Description** local description not available

---

**Recharge vehicle battery**  
Flat rate unit I 61 21 528

---

**Performing vehicle test**  
Flat rate unit I 00 00 556

---

**Vehicle diagnosis - carrying out the ABL**  
Flat rate unit I 61 00 006

---

**Removing and installing headliner**  
Flat rate unit I 51 44 513

---

**Job time without allowance for / electrical system**  
Flat rate unit I 61 99 000

---

**Shrinking hose** 20.0  
Part I 61 13 1 379 833

---

**Cable connector** 8.0  
Part I 61 13 8 353 748

---

**Cable connector** 20.0  
Part I 61 13 8 353 746

10/04/14 143195 km 21188

Job: local description not available

**Description** local description not available

10/12/13 136456 km 21188

Job: local description not available

**Description** local description not available

---

**Removing and installing/sealing or replacing oil pan**  
Flat rate unit I 11 13 000

---

**Set of aluminium screws oil pan** 1.0  
Part I 11 13 2 210 959

---

			<b>Profile-gasket</b>	1.0
			Part I 11 13 7 548 031	
			<b>Torx screw</b>	1.0
			Part I 11 13 7 559 537	
			<b>Collar nut</b>	2.0
			Part I 33 41 1 133 785	
10/12/13	136456 km	21188		
			Job: local description not available	
			<b>Description</b>	local description not available
18/11/13	135745 km	21188		
			Job: local description not available	
			<b>Description</b>	local description not available
			<b>Removing and installing or replacing both rear brake discs</b>	
			Flat rate unit I 34 21 928	
			<b>Repair kit, brake pads asbestos-free</b>	1.0
			Part I 34 21 6 763 044	
			<b>Brake disc, ventilated</b>	2.0
			Part I 34 21 6 763 345	
			<b>Brake pad wear sensor</b>	1.0
			Part I 34 35 6 789 494	
			Job: local description not available	
			<b>Description</b>	local description not available
			<b>Engine oil service</b>	
			Flat rate unit I 00 00 610	
			<b>Motor oil SAE 5W-30 LL01 1 L</b>	7.0
			Part I 07 51 0 017 866	
			<b>Set oil-filter element</b>	1.0
			Part I 11 42 7 566 327	
06/08/13	130839 km	36721		
			Job: local description not available	
			<b>Description</b>	local description not available
			<b>Removing and installing or replacing oil cooler</b>	
			Flat rate unit I 17 11 610	
			<b>O-ring</b>	2.0
			Part I 17 22 7 558 508	

Engine-oil cooler 1.0  
Part I 17 21 7 560 965

---

O-ring 2.0  
Part I 17 22 2 245 358

Job: local description not available

Description local description not available

---

Removing and installing or replacing flat motor for rear left or right power window regulator  
Flat rate unit I 67 62 020

---

Drive, window lifter, rear left 1.0  
Part I 67 62 6 922 319

06/08/13 130839 km 36721

Job: local description not available

Description local description not available

06/08/13 3352 km 36721

Job: Drive unit, rear window regulators Permanent failure

Description Drive unit, rear window regulators Permanent failure

---

Removing and installing or replacing flat motor for rear left or right power window regulator  
Flat rate unit I 67 62 020

---

Drive, window lifter, rear left 1.0  
Part I 67 62 6 922 319

04/06/13 127488 km 36721

Job

Service - standard scope  
Flat rate unit I 00 00 105

Job: local description not available

Description local description not available

---

Removing and installing or replacing both front brake discs  
Flat rate unit I 34 11 609

---

Brake pad wear sensor, front left 1.0  
Part I 34 35 6 789 492

---

Brake disc, ventilated 2.0  
Part I 34 11 6 767 269

---

Repair kit, brake pads asbestos-free 1.0  
Part I 34 11 6 794 915

Job: local description not available

**Description** local description not available

---

**Removing and installing/sealing or replacing complete full flow oil filter**  
Flat rate unit | 11 42 520

---

**Gasket** 1.0  
Part | 11 42 7 537 293

---

**Gasket** 1.0  
Part | 11 42 7 525 335

Job: local description not available

**Description** local description not available

---

**Replacing rear left or right electrical window regulator**  
Flat rate unit | 51 37 503

---

**Window lifter without motor, rear left** 1.0  
Part | 51 35 7 184 745

---

**Drive, window lifter, rear left** 1.0  
Part | 67 62 6 922 319

Job

**Replacing fuel low-pressure sensor**  
Flat rate unit | 13 53 594

---

**Performing vehicle test**  
Flat rate unit | 00 00 556

---

**Sensor, low pressure** 1.0  
Part | 13 53 7 614 317

Job: local description not available

**Description** local description not available

04/06/13 127488 km 36721

Job: local description not available

**Description** local description not available

04/06/13 127488 km 36721

Job: Full-flow filter body Leaking

**Description** Full-flow filter body Leaking

---

**Removing and installing/sealing or replacing complete full flow oil filter**  
Flat rate unit | 11 42 520

---

**Motor oil SAE 5W-30 LL01 1 L** 1.0  
Part | 07 51 0 017 866

---

**Brake cleaner** 1.0  
Part | 83 19 2 180 806

---

			<b>Gasket</b>	1.0
			Part I 11 42 7 537 293	
			<b>Gasket</b>	1.0
			Part I 11 42 7 525 335	
04/06/13	23963 km	36721		
	Job: Full-flow filter body Leaking			
	<b>Description</b>		Full-flow filter body Leaking	
	<b>Removing and installing/sealing or replacing complete full flow oil filter</b>			
	Flat rate unit I 11 42 520			
			<b>Gasket</b>	1.0
			Part I 11 42 7 537 293	
			<b>Brake cleaner</b>	1.0
			Part I 83 19 2 180 806	
			<b>Motor oil SAE 5W-30 LL01 1 L</b>	1.0
			Part I 07 51 0 017 866	
			<b>Gasket</b>	1.0
			Part I 11 42 7 525 335	
27/04/12	103525 km	36721		
	Job: local description not available			
	<b>Description</b>		local description not available	
	<b>Removing and installing/sealing or replacing complete full flow oil filter</b>			
	Flat rate unit I 11 42 520			
			<b>Fuel filter with fuel level sensor, left</b>	1.0
			Part I 16 14 7 174 895	
	Job			
	<b>Removing and installing or replacing fuel level sender for fuel gauge</b>			
	Flat rate unit I 16 12 501			
	<b>Job time without allowance for / fuel supply</b>			
	Flat rate unit I 16 99 000			
			<b>Gasket</b>	1.0
			Part I 11 42 7 537 293	
27/04/12	103525 km	36721		
	Job: local description not available			
	<b>Description</b>		local description not available	
21/12/11	95705 km	76561		
	Job: local description not available			

			Description	local description not available	
21/12/11	95705 km	76561			
			Job: local description not available		
			Description	local description not available	
			Replacing rear left or right electrical window regulator		
			Flat rate unit   51 37 503		
			Window lifter without motor, rear right		1.0
			Part   51 35 7 184 746		
07/12/11	95550 km	76561			
			Job		
			Replacing gear selector lever		
			Flat rate unit   61 31 843		
			Performing vehicle test		
			Flat rate unit   00 00 006		
			Programming/encoding control unit(s) (with CAS)		
			Flat rate unit   61 00 720		
			Gear selector switch		1.0
			Part   61 31 9 204 091		
07/12/11	95550 km	76561			
			Job: local description not available		
			Description	local description not available	
14/09/11	93248 km	76561			
			Job: E60 E61 E71 E82 E88 E89 E9x N54 US Replacing high-pressure pump (part II)		
			Description	E60 E61 E71 E82 E88 E89 E9x N54 US Replacing high-pressure pump (part II)	
			Performing vehicle test, reading fault code memory, checking low pressure sensor if necessary, replacing high pressure pump,clearing fault code memory		
			Flat rate unit   00 59 082		
			ASA-Bolt		1.0
			Part   13 53 7 582 770		
			Exch high-pressure pump		1.0
			Part   13 51 7 616 170		
26/01/11	78106 km	16280			
			Job: Front brake pad wear sensor Unpleasant noises		
			Description	Front brake pad wear sensor Unpleasant noises	

**Removing and installing or replacing both front brake discs**

Flat rate unit | 34 11 220

<b>Brake pad wear sensor, front left</b>	<b>1.0</b>
Part   34 35 6 789 492	

<b>Brake disc, ventilated</b>	<b>2.0</b>
Part   34 11 6 767 269	

<b>Repair kit, brake pads asbestos-free</b>	<b>1.0</b>
Part   34 11 6 794 915	

Job: Rear brake pad wear sensor Unpleasant noises

<b>Description</b>	Rear brake pad wear sensor Unpleasant noises
--------------------	--

**Removing and installing or replacing brake pads of both rear disc brakes**

Flat rate unit | 34 21 739

<b>Brake pad wear sensor</b>	<b>1.0</b>
Part   34 35 6 789 494	

<b>Repair kit, brake pads asbestos-free</b>	<b>1.0</b>
Part   34 21 6 763 044	

19/10/10                      69963 km                      16280

Job: E6x E7x E8x E9x F0x F10 N53 N54 N55 Programming control units (high pressure pump)

<b>Description</b>	E6x E7x E8x E9x F0x F10 N53 N54 N55 Programming control units (high pressure pump)
--------------------	--

**Programming control units and performing complete coding**

Flat rate unit | 00 59 612

19/10/10                      69963 km                      16280

Job: Side light bulb Permanent failure

<b>Description</b>	Side light bulb Permanent failure
--------------------	-----------------------------------

**Replacing lamp bulb for front right side light**

Flat rate unit | 63 99 656

<b>Bulb</b>	<b>1.0</b>
Part   07 11 9 906 503	

Job: Windscreen cover (top, outer sides) Loose

<b>Description</b>	Windscreen cover (top, outer sides) Loose
--------------------	---

<b>Cover, windshield</b>	<b>1.0</b>
Part   51 31 7 166 841	

27/07/10                      62387 km                      16280

Job: Interior strip/decor trim, dashboard Loose

<b>Description</b>	Interior strip/decor trim, dashboard Loose
--------------------	--



**Insert** 2.0  
**Part I 07 14 7 146 317**  
 Job: Side light bulb Permanent failure

**Description** Side light bulb Permanent failure

---

**Replacing lamp bulb for front left side light**  
 Flat rate unit I 63 99 632

---

**Bulb** 1.0  
**Part I 07 11 9 906 503**

Job: Drink holder, front Does not lock into position

**Description** Drink holder, front Does not lock into position

---

**Removing and installing/replacing front cup holder**  
 Flat rate unit I 51 16 702

---

**Drink holder, outer** 1.0  
**Part I 51 45 9 125 626**

---

**Drink holder, inner** 1.0  
**Part I 51 45 9 125 622**

18/06/10 57911 km 16280

Job: Navigation CCC (Car Communication Computer) Navi Professional, failure Software error / internal dev

**Description** Navigation CCC (Car Communication Computer) Navi Professional, failure Software error / internal dev

---

**Continuing vehicle test and performing Quick delete**  
 Flat rate unit I 61 00 980

---

**Job time without allowance for / electrical system**  
 Flat rate unit I 61 99 000

---

**Job time without allowance for / electrical system**  
 Flat rate unit I 61 99 000

---

**Replacing Car Communication Computer**  
 Flat rate unit I 65 83 511

---

**Initialising sunroof and power windows**  
 Flat rate unit I 61 00 830

---

**Performing vehicle test**  
 Flat rate unit I 00 00 556

---

**Resetting the RDC**  
 Flat rate unit I 36 11 503

---

**Job time without allowance for / radio and special equipment**  
 Flat rate unit I 65 99 000

---

**Adjusting steering angle sensor**  
 Flat rate unit I 61 31 996

---

**TeileClearing, lump-sum fee**

Flat rate unit I 00 58 677

Exchange-CCC CD

Part I 65 83 9 156 237

1.0

Job

**Service, vehicle check**

Flat rate unit I 00 00 624

Job

**Service - standard scope**

Flat rate unit I 00 00 105

25/05/10

55494 km

16280

Job

**Service - standard scope**

Flat rate unit I 00 00 105

Job: local description not available

**Description**

local description not available

**Engine oil service**

Flat rate unit I 00 00 610

**Set oil-filter element**

Part I 11 42 7 566 327

1.0

**Motor oil SAE 5W-30 LL01 1 L**

Part I 07 51 0 017 866

7.0

Job: local description not available

**Description**

local description not available

**Brake fluid service**

Flat rate unit I 00 00 618

**Brake fluid**

Part I 81 22 0 142 156

3.0

Job: local description not available

**Description**

local description not available

**Microfilter service**

Flat rate unit I 00 00 616

**Microfilter/activated Carbon container**

Part I 64 31 9 171 858

2.0

Job: E8x E9x E6x E7x R5x (with option SA 609) CCC - navigations DVD not recognised/read

**Description**

E8x E9x E6x E7x R5x (with option SA 609) CCC - navigations DVD not recognised/read

Performing vehicle test and replacing DVD drive for car communication computer			
Flat rate unit   00 58 738			
Exchange DVD drive			1.0
Part   65 83 9 237 706			
Job: local description not available			
Description		local description not available	
23/02/10	47058 km	16280	
Job: Fuel injector Fault code in diagnosis memory (warn. lamp on)			
Description		Fuel injector Fault code in diagnosis memory (warn. lamp on)	
Interrogating fault memory in diagnosing system			
Flat rate unit   00 00 555			
Programming/encoding control unit(s) (with CAS)			
Flat rate unit   61 00 812			
Removing and installing/renewing all spark plugs			
Flat rate unit   12 12 521			
Removing and installing or replacing all injectors of fuel injection system			
Flat rate unit   13 53 585			
Adjusting steering angle sensor			
Flat rate unit   61 31 996			
Initialising sunroof and power windows			
Flat rate unit   61 00 830			
Injector			6.0
Part   13 53 7 585 261			
Injector			6.0
Part   13 53 7 585 261			
Injector			6.0
Part   13 53 7 585 261			
Injector			6.0
Part   13 53 7 585 261			
Injector			6.0
Part   13 53 7 585 261			
Injector			6.0
Part   13 53 7 585 261			
Spark plug, High Power			6.0
Part   12 12 0 037 244			
Decoupling element			6.0
Part   13 53 7 564 751			

20/02/10	46561 km	86513	
Job: Fuel temperature sensor / pressure sensor (fuel-pressure sensor) Permanent malfunction			
<b>Description</b>	Fuel temperature sensor / pressure sensor (fuel-pressure sensor) Permanent malfunction		
<hr/>			
<b>Replacing fuel low-pressure sensor</b>			
Flat rate unit   13 53 594			
<hr/>			
<b>Job time without allowance for / fuel conditioning</b>			
Flat rate unit   13 99 000			
<hr/>			
<b>Interrogating fault memory in diagnosing system</b>			
Flat rate unit   00 00 555			
<hr/>			
<b>Sensor, low pressure</b>			<b>1.0</b>
Part   13 53 7 547 883			
21/01/10	43805 km	16280	
Job: High pressure pump HDP Permanent failure			
<b>Description</b>	High pressure pump HDP Permanent failure		
<hr/>			
<b>Checking delivery pressure of fuel pump</b>			
Flat rate unit   13 31 529			
<hr/>			
<b>Replacing high pressure pump</b>			
Flat rate unit   13 51 518			
<hr/>			
<b>TeileClearing, lump-sum fee</b>			
Flat rate unit   00 58 677			
<hr/>			
<b>ASA-Bolt</b>			<b>1.0</b>
Part   13 53 7 582 770			
<hr/>			
<b>High-pressure pump</b>			<b>1.0</b>
Part   13 51 7 592 881			
28/08/09	31625 km	16280	
Job: Rear window regulator operating cable Cracked / broken / torn off			
<b>Description</b>	Rear window regulator operating cable Cracked / broken / torn off		
<hr/>			
<b>Replacing rear left or right electrical window regulator</b>			
Flat rate unit   51 37 003			
<hr/>			
<b>Window lifter without motor, rear left</b>			<b>1.0</b>
Part   51 35 7 184 745			
09/06/09	24446 km	16280	
Job			
<b>Service - standard scope</b>			
Flat rate unit   00 00 105			

Job: local description not available

**Description** local description not available

---

**Engine oil service**  
Flat rate unit | 00 00 610

---

**Motor oil SAE 5W-30 Longlife 01** 7.0  
Part | 07 51 0 017 954

---

**Set oil-filter element** 1.0  
Part | 11 42 7 566 327

---

Job: local description not available

**Description** local description not available

---

**Microfilter service**  
Flat rate unit | 00 00 616

---

**Microfilter/activated Carbon container** 2.0  
Part | 64 31 9 171 858

---

Job: local description not available

**Description** local description not available

---

26/05/09 23351 km 16280

Job: Rear window regulator operating cable Cracked / broken / torn off

**Description** Rear window regulator operating cable Cracked / broken / torn off

---

**Removing and installing left or right rear power window regulator**  
Flat rate unit | 51 37 000

---

**Window lifter without motor, rear left** 1.0  
Part | 51 35 7 184 745

---

21/11/08 7062 km 16280

Job: Oxygen control sensor (before catalytic converter) Occasional malfunction

**Description** Oxygen control sensor (before catalytic converter) Occasional malfunction

---

**Interrogating fault memory in diagnosing system**  
Flat rate unit | 00 00 005

---

**Job time without allowance for / engine**  
Flat rate unit | 11 99 000

---

29/07/08 5 km 16280

Job: local description not available

**Description** local description not available

---

BMW QC1-Spot Delivery  
Flat rate unit | 00 00 012

---

### Repair history/customer complaint history

---

Date of repair	Vehicle mileage	Retailer	
23/05/14	145571 km	21188	
Job			
<b>Description</b>		local description not available	
<hr/>			
Replacing left front door sensor			
Flat rate unit   65 77 741			
<hr/>			
Sensor door			1.0
Part   65 77 9 118 167			
Job			
Removing and installing/replacing both exhaust turbochargers			
Flat rate unit   11 65 548			
<hr/>			
Recharge vehicle battery			
Flat rate unit   61 21 528			
<hr/>			
Performing vehicle test			
Flat rate unit   00 00 556			
<hr/>			
Collar nut			1.0
Part   33 41 1 133 785			
<hr/>			
Flat gasket			2.0
Part   18 30 7 553 603			
<hr/>			
Gasket exh.turbocharger/catalytic conv.			2.0
Part   18 30 7 553 601			
<hr/>			
Exch-turbo charger			1.0
Part   11 65 7 649 293			
<hr/>			
R134 A Gas			15.0
Part   83 19 2 221 349			
<hr/>			
O-ring			12.0
Part   11 42 7 558 936			
<hr/>			
Gasket Asbestos Free			2.0
Part   11 42 2 246 091			
<hr/>			
Exch-turbo charger			1.0
Part   11 65 7 649 292			
<hr/>			
Gasket ring			6.0
Part   11 62 7 558 906			
<hr/>			
			1.0

<b>Gasket</b>			
Part I 11 53 7 545 302			
<b>O-ring</b>			2.0
Part I 11 42 7 563 453			
23/05/14	145571 km	21188	
Job			
<b>Description</b>		local description not available	
10/04/14	143195 km	21188	
Job			
<b>Service - standard scope</b>			
Flat rate unit I 00 00 105			
Job			
<b>Description</b>		local description not available	
<b>Brake fluid service</b>			
Flat rate unit I 00 00 618			
<b>Brake fluid</b>			2.0
Part I 81 22 0 142 156			
Job			
<b>Description</b>		local description not available	
<b>Microfilter service</b>			
Flat rate unit I 00 00 616			
<b>Microfilter/activated Carbon container</b>			2.0
Part I 64 31 9 171 858			
Job			
<b>Description</b>		local description not available	
<b>Recharge vehicle battery</b>			
Flat rate unit I 61 21 528			
<b>Performing vehicle test</b>			
Flat rate unit I 00 00 556			
<b>Vehicle diagnosis - carrying out the ABL</b>			
Flat rate unit I 61 00 006			
<b>Removing and installing headliner</b>			
Flat rate unit I 51 44 513			
<b>Job time without allowance for / electrical system</b>			
Flat rate unit I 61 99 000			
<b>Shrinking hose</b>			20.0
Part I 61 13 1 379 833			

			<b>Cable connector</b>	<b>8.0</b>
			Part I 61 13 8 353 748	
			<b>Cable connector</b>	<b>20.0</b>
			Part I 61 13 8 353 746	
10/04/14	143195 km	21188		
			Job	
			<b>Description</b>	local description not available
10/12/13	136456 km	21188		
			Job	
			<b>Description</b>	local description not available
			<b>Removing and installing/sealing or replacing oil pan</b>	
			Flat rate unit I 11 13 000	
			<b>Set of aluminium screws oil pan</b>	<b>1.0</b>
			Part I 11 13 2 210 959	
			<b>Profile-gasket</b>	<b>1.0</b>
			Part I 11 13 7 548 031	
			<b>Torx screw</b>	<b>1.0</b>
			Part I 11 13 7 559 537	
			<b>Collar nut</b>	<b>2.0</b>
			Part I 33 41 1 133 785	
10/12/13	136456 km	21188		
			Job	
			<b>Description</b>	local description not available
18/11/13	135745 km	21188		
			Job	
			<b>Description</b>	local description not available
			<b>Removing and installing or replacing both rear brake discs</b>	
			Flat rate unit I 34 21 928	
			<b>Repair kit, brake pads asbestos-free</b>	<b>1.0</b>
			Part I 34 21 6 763 044	
			<b>Brake disc, ventilated</b>	<b>2.0</b>
			Part I 34 21 6 763 345	
			<b>Brake pad wear sensor</b>	<b>1.0</b>
			Part I 34 35 6 789 494	



Job		
<b>Description</b>		local description not available
<hr/>		
Engine oil service Flat rate unit   00 00 610		
<hr/>		
Motor oil SAE 5W-30 LL01 1 L Part   07 51 0 017 866		7.0
<hr/>		
Set oil-filter element Part   11 42 7 566 327		1.0

06/08/13      130839 km      36721

Job

<b>Description</b>		local description not available
<hr/>		
Removing and installing or replacing oil cooler Flat rate unit   17 11 610		
<hr/>		
O-ring Part   17 22 7 558 508		2.0
<hr/>		
Engine-oil cooler Part   17 21 7 560 965		1.0
<hr/>		
O-ring Part   17 22 2 245 358		2.0

Job

<b>Description</b>		local description not available
<hr/>		
Removing and installing or replacing flat motor for rear left or right power window regulator Flat rate unit   67 62 020		
<hr/>		
Drive, window lifter, rear left Part   67 62 6 922 319		1.0

06/08/13      130839 km      36721

Job

<b>Description</b>		local description not available
--------------------	--	---------------------------------

06/08/13      3352 km      36721

Job

<b>Description</b>		Drive unit, rear window regulators Permanent failure
<hr/>		
Removing and installing or replacing flat motor for rear left or right power window regulator Flat rate unit   67 62 020		
<hr/>		
		1.0

Drive, window lifter, rear left  
 Part I 67 62 6 922 319

04/06/13 127488 km 36721

Job

Service - standard scope  
 Flat rate unit I 00 00 105

Job

Description local description not available

---

Removing and installing or replacing both front brake discs  
 Flat rate unit I 34 11 609

---

Brake pad wear sensor, front left	1.0
Part I 34 35 6 789 492	

---

Brake disc, ventilated	2.0
Part I 34 11 6 767 269	

---

Repair kit, brake pads asbestos-free	1.0
Part I 34 11 6 794 915	

---

Job

Description local description not available

---

Removing and installing/sealing or replacing complete full flow oil filter  
 Flat rate unit I 11 42 520

---

Gasket	1.0
Part I 11 42 7 537 293	

---

Gasket	1.0
Part I 11 42 7 525 335	

---

Job

Description local description not available

---

Replacing rear left or right electrical window regulator  
 Flat rate unit I 51 37 503

---

Window lifter without motor, rear left	1.0
Part I 51 35 7 184 745	

---

Drive, window lifter, rear left	1.0
Part I 67 62 6 922 319	

---

Job

Replacing fuel low-pressure sensor  
 Flat rate unit I 13 53 594

---

Performing vehicle test  
 Flat rate unit I 00 00 556

---

			<b>Sensor, low pressure</b>	1.0
			Part I 13 53 7 614 317	
			Job	
			<b>Description</b>	local description not available
04/06/13	127488 km	36721		
			Job	
			<b>Description</b>	local description not available
04/06/13	127488 km	36721		
			Job	
			<b>Description</b>	Full-flow filter body Leaking
<hr/>				
<b>Removing and installing/sealing or replacing complete full flow oil filter</b>				
Flat rate unit I 11 42 520				
<hr/>				
			<b>Motor oil SAE 5W-30 LL01 1 L</b>	1.0
			Part I 07 51 0 017 866	
<hr/>				
			<b>Brake cleaner</b>	1.0
			Part I 83 19 2 180 806	
<hr/>				
			<b>Gasket</b>	1.0
			Part I 11 42 7 537 293	
<hr/>				
			<b>Gasket</b>	1.0
			Part I 11 42 7 525 335	
04/06/13	23963 km	36721		
			Job	
			<b>Description</b>	Full-flow filter body Leaking
<hr/>				
<b>Removing and installing/sealing or replacing complete full flow oil filter</b>				
Flat rate unit I 11 42 520				
<hr/>				
			<b>Gasket</b>	1.0
			Part I 11 42 7 537 293	
<hr/>				
			<b>Brake cleaner</b>	1.0
			Part I 83 19 2 180 806	
<hr/>				
			<b>Motor oil SAE 5W-30 LL01 1 L</b>	1.0
			Part I 07 51 0 017 866	
<hr/>				
			<b>Gasket</b>	1.0
			Part I 11 42 7 525 335	
27/04/12	103525 km	36721		
			Job	

			<b>Description</b>	local description not available	
			Removing and installing/sealing or replacing complete full flow oil filter Flat rate unit   11 42 520		
			Fuel filter with fuel level sensor, left Part   16 14 7 174 895		1.0
			Job Removing and installing or replacing fuel level sender for fuel gauge Flat rate unit   16 12 501		
			Job time without allowance for / fuel supply Flat rate unit   16 99 000		
			Gasket Part   11 42 7 537 293		1.0
27/04/12	103525 km	36721			
			Job <b>Description</b>	local description not available	
21/12/11	95705 km	76561			
			Job <b>Description</b>	local description not available	
21/12/11	95705 km	76561			
			Job <b>Description</b>	local description not available	
			Replacing rear left or right electrical window regulator Flat rate unit   51 37 503		
			Window lifter without motor, rear right Part   51 35 7 184 746		1.0
07/12/11	95550 km	76561			
			Job Replacing gear selector lever Flat rate unit   61 31 843		
			Performing vehicle test Flat rate unit   00 00 006		
			Programming/encoding control unit(s) (with CAS) Flat rate unit   61 00 720		
			Gear selector switch Part   61 31 9 204 091		1.0

07/12/11	95550 km	76561
Job		
<b>Description</b>	local description not available	
14/09/11	93248 km	76561
Job		
<b>Description</b>	E60 E61 E71 E82 E88 E89 E9x N54 US Replacing high-pressure pump (part II)	
Performing vehicle test, reading fault code memory, checking low pressure sensor if necessary, replacing high pressure pump,clearing fault code memory Flat rate unit I 00 59 082		
<b>ASA-Bolt</b>		1.0
Part I 13 53 7 582 770		
<b>Exch high-pressure pump</b>		1.0
Part I 13 51 7 616 170		
26/01/11	78106 km	16280
Job		
<b>Description</b>	Front brake pad wear sensor Unpleasant noises	
Removing and installing or replacing both front brake discs Flat rate unit I 34 11 220		
<b>Brake pad wear sensor, front left</b>		1.0
Part I 34 35 6 789 492		
<b>Brake disc, ventilated</b>		2.0
Part I 34 11 6 767 269		
<b>Repair kit, brake pads asbestos-free</b>		1.0
Part I 34 11 6 794 915		
Job		
<b>Description</b>	Rear brake pad wear sensor Unpleasant noises	
Removing and installing or replacing brake pads of both rear disc brakes Flat rate unit I 34 21 739		
<b>Brake pad wear sensor</b>		1.0
Part I 34 35 6 789 494		
<b>Repair kit, brake pads asbestos-free</b>		1.0
Part I 34 21 6 763 044		
19/10/10	69963 km	16280
Job		
<b>Description</b>	E6x E7x E8x E9x F0x F10 N53 N54 N55 Programming control units (high pressure pump)	

<b>Programming control units and performing complete coding</b>		
Flat rate unit   00 59 612		
19/10/10	69963 km	16280
Job		
<b>Description</b>		Side light bulb Permanent failure
<b>Replacing lamp bulb for front right side light</b>		
Flat rate unit   63 99 656		
<b>Bulb</b>		1.0
Part   07 11 9 906 503		
Job		
<b>Description</b>		Windscreen cover (top, outer sides) Loose
<b>Cover, windshield</b>		1.0
Part   51 31 7 166 841		
27/07/10	62387 km	16280
Job		
<b>Description</b>		Interior strip/decor trim, dashboard Loose
<b>Insert</b>		2.0
Part   07 14 7 146 317		
Job		
<b>Description</b>		Side light bulb Permanent failure
<b>Replacing lamp bulb for front left side light</b>		
Flat rate unit   63 99 632		
<b>Bulb</b>		1.0
Part   07 11 9 906 503		
Job		
<b>Description</b>		Drink holder, front Does not lock into position
<b>Removing and installing/replacing front cup holder</b>		
Flat rate unit   51 16 702		
<b>Drink holder, outer</b>		1.0
Part   51 45 9 125 626		
<b>Drink holder, inner</b>		1.0
Part   51 45 9 125 622		
18/06/10	57911 km	16280
Job		

<b>Description</b>	Navigation CCC (Car Communication Computer) Navi Professional, failure Software error / internal dev		
<hr/>			
<b>Continuing vehicle test and performing Quick delete</b>			
Flat rate unit   61 00 980			
<hr/>			
<b>Job time without allowance for / electrical system</b>			
Flat rate unit   61 99 000			
<hr/>			
<b>Job time without allowance for / electrical system</b>			
Flat rate unit   61 99 000			
<hr/>			
<b>Replacing Car Communication Computer</b>			
Flat rate unit   65 83 511			
<hr/>			
<b>Initialising sunroof and power windows</b>			
Flat rate unit   61 00 830			
<hr/>			
<b>Performing vehicle test</b>			
Flat rate unit   00 00 556			
<hr/>			
<b>Resetting the RDC</b>			
Flat rate unit   36 11 503			
<hr/>			
<b>Job time without allowance for / radio and special equipment</b>			
Flat rate unit   65 99 000			
<hr/>			
<b>Adjusting steering angle sensor</b>			
Flat rate unit   61 31 996			
<hr/>			
<b>TeileClearing, lump-sum fee</b>			
Flat rate unit   00 58 677			
<hr/>			
<b>Exchange-CCC CD</b>			1.0
Part   65 83 9 156 237			
<hr/>			
Job			
<b>Service, vehicle check</b>			
Flat rate unit   00 00 624			
<hr/>			
Job			
<b>Service - standard scope</b>			
Flat rate unit   00 00 105			
<hr/>			
25/05/10	55494 km	16280	
<hr/>			
Job			
<b>Service - standard scope</b>			
Flat rate unit   00 00 105			
<hr/>			
Job			
<b>Description</b>	local description not available		
<hr/>			
<b>Engine oil service</b>			
Flat rate unit   00 00 610			
<hr/>			

<b>Set oil-filter element</b>			<b>1.0</b>
Part I 11 42 7 566 327			
<b>Motor oil SAE 5W-30 LL01 1 L</b>			<b>7.0</b>
Part I 07 51 0 017 866			
Job			
<b>Description</b>		local description not available	
<b>Brake fluid service</b>			
Flat rate unit I 00 00 618			
<b>Brake fluid</b>			<b>3.0</b>
Part I 81 22 0 142 156			
Job			
<b>Description</b>		local description not available	
<b>Microfilter service</b>			
Flat rate unit I 00 00 616			
<b>Microfilter/activated Carbon container</b>			<b>2.0</b>
Part I 64 31 9 171 858			
Job			
<b>Description</b>		E8x E9x E6x E7x R5x (with option SA 609) CCC - navigations DVD not recognised/read	
<b>Performing vehicle test and replacing DVD drive for car communication computer</b>			
Flat rate unit I 00 58 738			
<b>Exchange DVD drive</b>			<b>1.0</b>
Part I 65 83 9 237 706			
Job			
<b>Description</b>		local description not available	
23/02/10	47058 km	16280	
Job			
<b>Description</b>		Fuel injector Fault code in diagnosis memory (warn. lamp on)	
<b>Interrogating fault memory in diagnosing system</b>			
Flat rate unit I 00 00 555			
<b>Programming/encoding control unit(s) (with CAS)</b>			
Flat rate unit I 61 00 812			
<b>Removing and installing/renewing all spark plugs</b>			
Flat rate unit I 12 12 521			
<b>Removing and installing or replacing all injectors of fuel injection system</b>			
Flat rate unit I 13 53 585			



Adjusting steering angle sensor

Flat rate unit | 61 31 996

Initialising sunroof and power windows

Flat rate unit | 61 00 830

Injector 6.0

Part | 13 53 7 585 261

Injector 6.0

Part | 13 53 7 585 261

Injector 6.0

Part | 13 53 7 585 261

Injector 6.0

Part | 13 53 7 585 261

Injector 6.0

Part | 13 53 7 585 261

Injector 6.0

Part | 13 53 7 585 261

Spark plug, High Power 6.0

Part | 12 12 0 037 244

Decoupling element 6.0

Part | 13 53 7 564 751

20/02/10 46561 km 86513

Job

Description Fuel temperature sensor / pressure sensor (fuel-pressure sensor)  
Permanent malfunction

Replacing fuel low-pressure sensor

Flat rate unit | 13 53 594

Job time without allowance for / fuel conditioning

Flat rate unit | 13 99 000

Interrogating fault memory in diagnosing system

Flat rate unit | 00 00 555

Sensor, low pressure 1.0

Part | 13 53 7 547 883

21/01/10 43805 km 16280

Job

Description High pressure pump HDP Permanent failure

Checking delivery pressure of fuel pump

Flat rate unit | 13 31 529

<b>Replacing high pressure pump</b>		
Flat rate unit   13 51 518		
<hr/>		
<b>TeileClearing, lump-sum fee</b>		
Flat rate unit   00 58 677		
<hr/>		
<b>ASA-Bolt</b>		
Part   13 53 7 582 770		
<hr/>		
<b>High-pressure pump</b>		
Part   13 51 7 592 881		
<hr/>		
28/08/09	31625 km	16280
Job		
<b>Description</b> Rear window regulator operating cable Cracked / broken / torn off		
<hr/>		
<b>Replacing rear left or right electrical window regulator</b>		
Flat rate unit   51 37 003		
<hr/>		
<b>Window lifter without motor, rear left</b>		
Part   51 35 7 184 745		
<hr/>		
09/06/09	24446 km	16280
Job		
<b>Service - standard scope</b>		
Flat rate unit   00 00 105		
<hr/>		
Job		
<b>Description</b> local description not available		
<hr/>		
<b>Engine oil service</b>		
Flat rate unit   00 00 610		
<hr/>		
<b>Motor oil SAE 5W-30 Longlife 01</b>		
Part   07 51 0 017 954		
<hr/>		
<b>Set oil-filter element</b>		
Part   11 42 7 566 327		
<hr/>		
Job		
<b>Description</b> local description not available		
<hr/>		
<b>Microfilter service</b>		
Flat rate unit   00 00 616		
<hr/>		
<b>Microfilter/activated Carbon container</b>		
Part   64 31 9 171 858		
<hr/>		
Job		
<b>Description</b> local description not available		
<hr/>		
26/05/09	23351 km	16280

Job

**Description** Rear window regulator operating cable Cracked / broken / torn off

---

**Removing and installing left or right rear power window regulator**

Flat rate unit | 51 37 000

---

**Window lifter without motor, rear left**

1.0

Part | 51 35 7 184 745

21/11/08            7062 km            16280

Job

**Description** Oxygen control sensor (before catalytic converter) Occasional malfunction

---

**Interrogating fault memory in diagnosing system**

Flat rate unit | 00 00 005

---

**Job time without allowance for / engine**

Flat rate unit | 11 99 000

29/07/08            5 km            16280

Job

**Description** local description not available

---

**BMW QC1-Spot Delivery**

Flat rate unit | 00 00 012