


Special tools required:

00 9 317




Necessary preliminary tasks:

Remove switch for hazard warning system/central locking

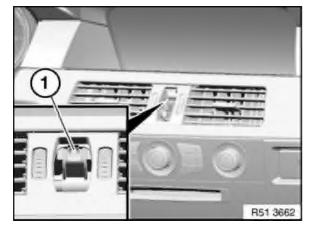



Unscrew bolt (1).

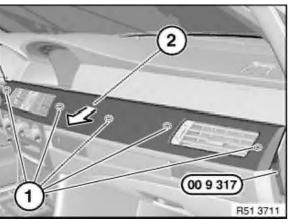

Lever out right decorative strip on instrument panel (2) at retaining points (1) with special tool 00 9 317

Disconnect associated plug connection and remove right decorative strip on instrument panel (2).

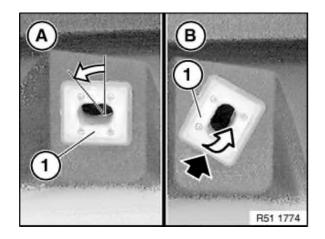



Installation:

Clips (1) must be seated in associated mountings.

If necessary, remove clips (1) remaining on right decorative strip for instrument panel.

Replace damaged clips (1).

- A Turn clip (1) with screwdriver to left by approx. 60 $^{\circ}$.
- B Lever out clip (1) from below.

Replacement:

- Remove right fresh-air grill
- Remove center fresh-air grill