

ZF6HP19/26/32 (Gen. 1)

Also fits Ford 6R60, 6R80.



Visit www.sonnax.com for ZF6 Gen. 1 with 053 separator plate valve body layout to verify valve location and part usage.

sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

This Sonnax kit is also available, see www.sonnax.com for details.




NOTE: Zip Kit will not fit units with 053 separator plate.

Zip Kit®
ZF6-6R60-ZIP

Click on Sonnax part numbers to see more information.

1 95740-05K Oversized Converter Release Regulator Valve Kit

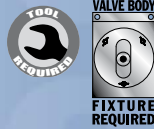

Helps cure:

- Excessive TCC slip, RPM & related codes
- Harsh lockup apply & release

Note: Requires tool kit F-95740-TL5 & the VB-FIX reaming fixture.

2 95740-11K Oversized Lubrication Control Valve Kit



Helps cure:

- Low converter pressure
- Lube failure

Note: Requires tool kit F-95740-TL11 & the VB-FIX reaming fixture.

3 95740-13K Oversized Bypass Clutch Control Valve Kit



Helps cure:

- Converter overheat
- Low TCC release pressure

Note: Requires tool kit F-95740-TL13 & the VB-FIX reaming fixture.

4 95740-03 .629" Outer Dia., .645" Length Pressure Regulator Sleeves



NOTE: Does not fit units with a 053 separator plate.

Helps cure:

- Harsh or erratic line pressure
- Broken parts

5 95740-01K With sleeve .629" Outer Dia., .645" Length Oversized Pressure Regulator Valve Kits



NOTE: Does not fit units with a 053 separator plate.

Oversized Pressure Regulator Valve Kits

Helps cure:

- Delayed or no Reverse
- Poor shift quality

Note: 95740-01K Requires tool kit F-95740-TL, 95740-78K Requires tool kit F-95740-TL78 & they both require VB-FIX reaming fixture.



NOTE: To Identify between ZF6HP19, ZF6HP26, ZF6HP32 (all Gen. 1) and ZF6HP21, ZF6HP28, ZF6HP34 (all Gen. 2) valve bodies refer to ZF Identification guide found online at www.sonnax.com.

©2017 Sonnax Industries, Inc.

The Sonnax products listed here may be protected by one or more patents, or be patent pending.

6 95740-17K Oversized Solenoid Pressure Regulator Valve Kit



Helps cure:

- Gear ratio or solenoid codes
- Wrong gear starts

Note: Requires tool kit F-95740-TL17 & the VB-FIX reaming fixture.

7 95740-08K



NOTE: Does not fit units with a 053 separator plate.

Oversized Clutch D1 or E Control Valve Kit

Fits either of 2 Locations




Helps cure:

- Flare upshifts or downshift bind-ups
- Excessive clutch overlap & clutch distress

Note: Requires tool kit F-95740-TL8 & the VB-FIX reaming fixture.

8 95740-09K Oversized Clutch A Control Valve Kit

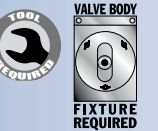

Helps cure:

- Flare upshifts or downshift bind-ups
- Excessive clutch overlap & clutch distress

Note: Requires tool kit F-95740-TL8 & the VB-FIX reaming fixture.

9 95740-21K Clutch A Control Boost Valve Kit

Helps cure:

- Delayed/Harsh Forward engagement
- Flare/Neutral on 5-4 downshift

10 95740-15K Valve Body Accumulator Piston & Spring Kit 7 Sets (1 extra)

Helps cure:

- Firm up/downshift and/or engagement
- Erratic EDS solenoid control

11 95740-19K 6 large & 6 small plugs



NOTE: Does not fit units with a 053 separator plate.

12 95740-25K 4 plugs (Internal)



NOTE: Does not fit units with a 053 separator plate.

O-Ringed End Plug Kits

Helps cure:

- Soft/Inconsistent shift feel