



# RELOCATING THE MULF

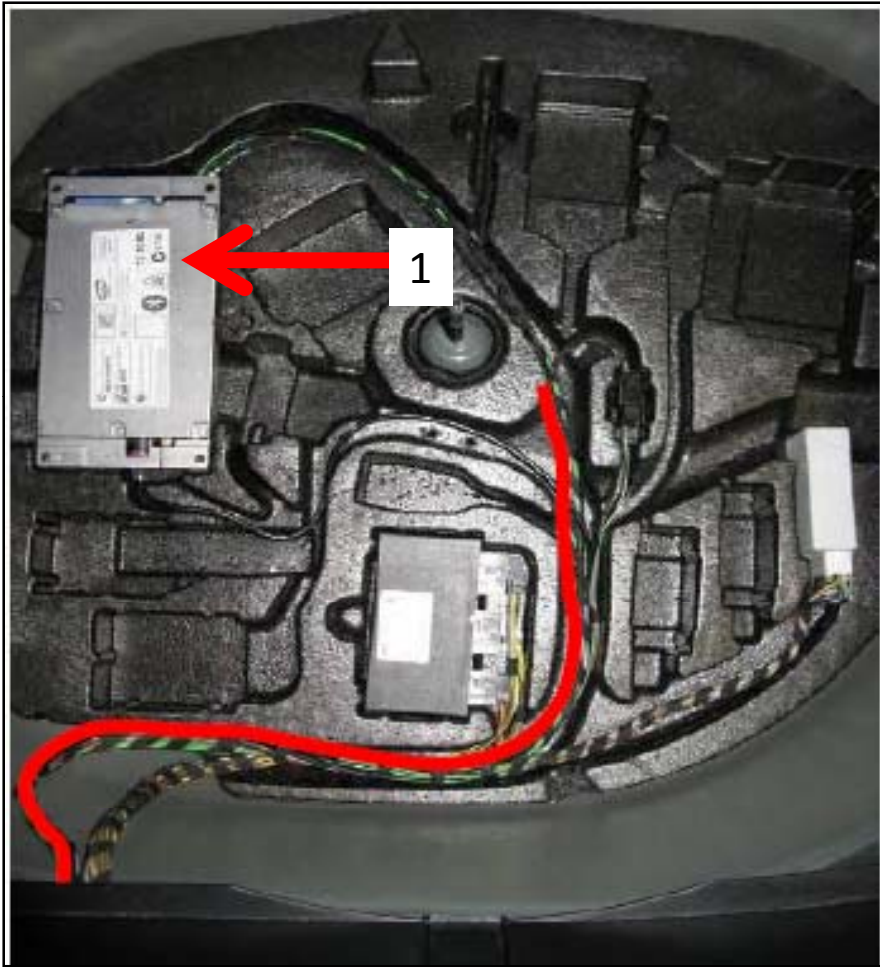


1) Remove the trim panels from the left and right side of the luggage compartment per Repair Instruction REP 51 47 210/220 and remove the tail panel trim.


2) Remove the MULF (1) and pull the wiring harness back along the red line.

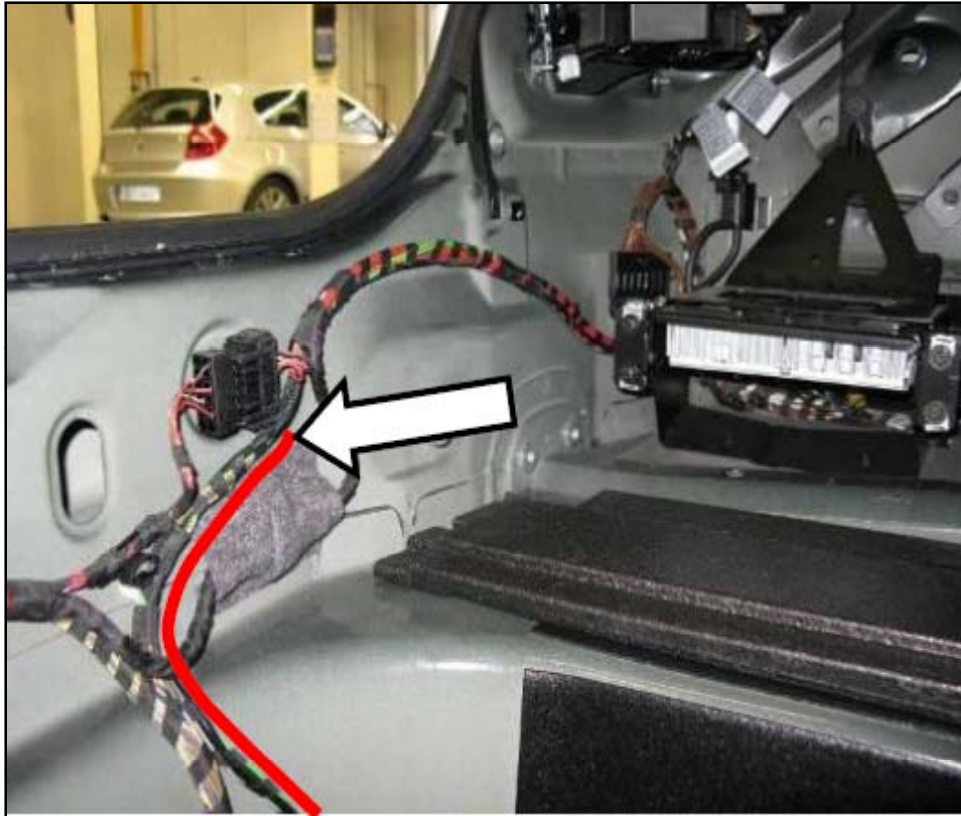

3) Continue pulling back the harness along the red line to the point shown by the arrow.

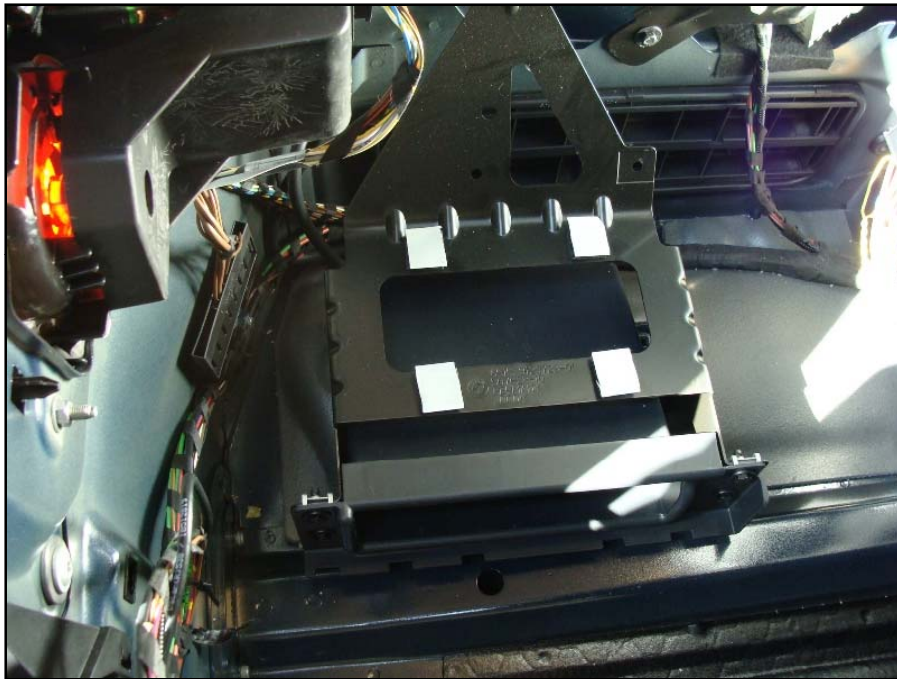


4) Secure the hook side of 2 pieces of Velcro to each other. Repeat 3 more times (using 8 pieces of Velcro in total). Peel the backing off one side of each Velcro pair and secure each to the bracket in the left side of the luggage compartment, as shown.

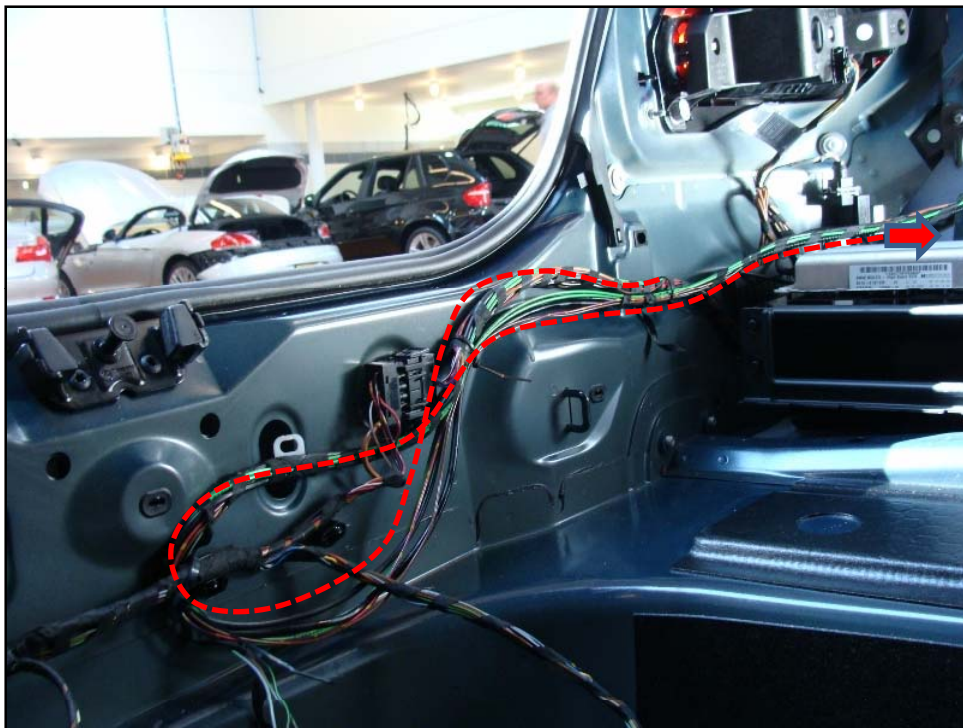

5) Route the harness for the MULF in a loop on the tail panel, as shown. This way, the harness will not have excess slack in it, and will allow the MULF to sit on top of the bracket in the left side of the luggage compartment.



6) Secure the harness in its new position, using 4 wire ties.

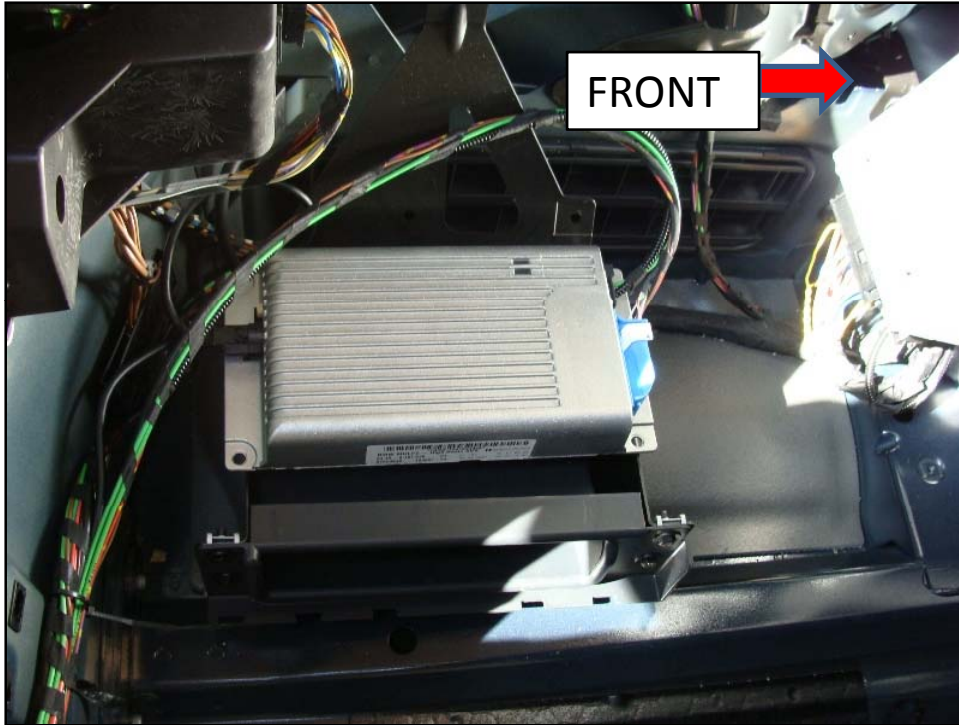

7) Remove the adhesive backing from the 4 Velcro pads and place the MULF on them, oriented with the connectors toward the front of the vehicle.




8) When reinstalling the luggage compartment trim panels, install a new left side panel, which has a shelf as opposed to an oddments tray.

## RELOCATING THE PDC Module




1) Remove the PDC Module (1) and pull the wiring harness back along the red line to the point identified by the arrow.



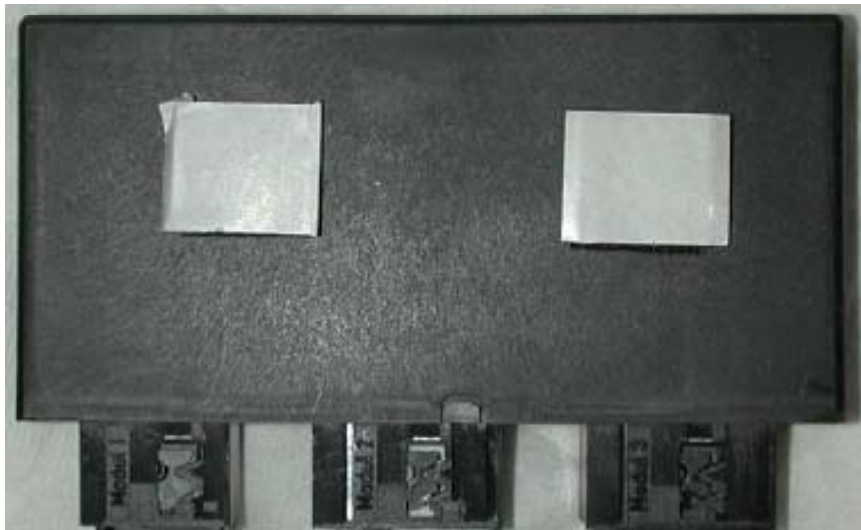

2) Secure the hook side of 2 pieces of Velcro to each other. Repeat once (using 4 pieces of Velcro in total). Peel the backing off one side of each Velcro pair and secure each to the back side of the PDC module, as shown.

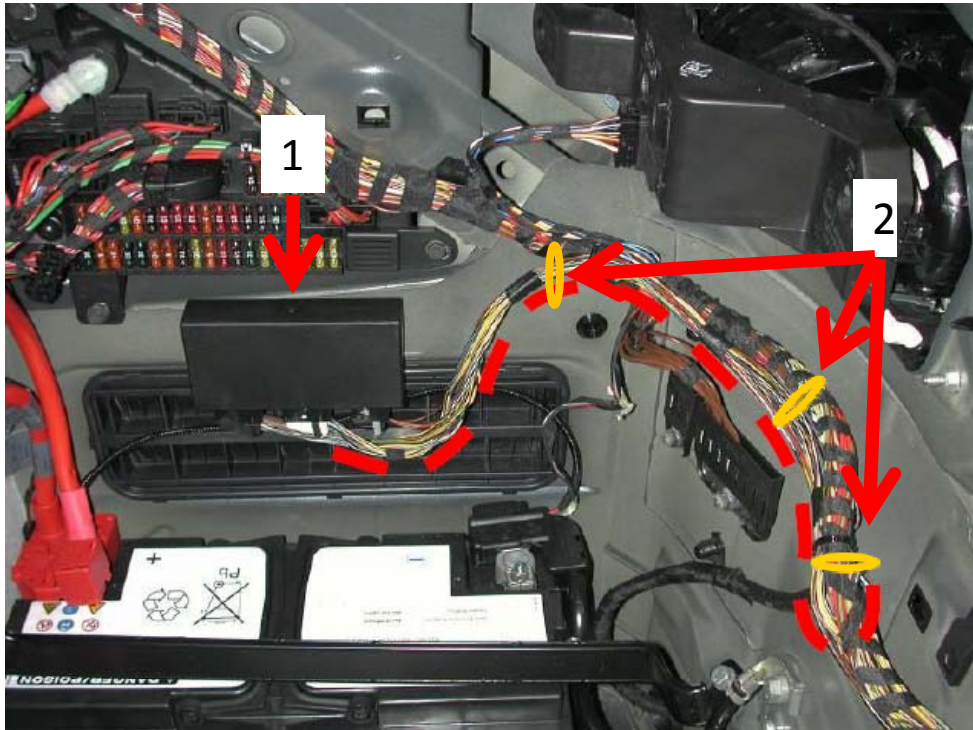

3) Route the PDC module (1) back along its own wiring harness to reach the point above the middle of the right side air extractor. Peel the backing off of the Velcro pads and secure the PDC module to the body structure. Secure the wiring harness with 3 wire ties (2). Replace any panels that have been removed.